

Release Notes for Netman 208

APP Version 1.10

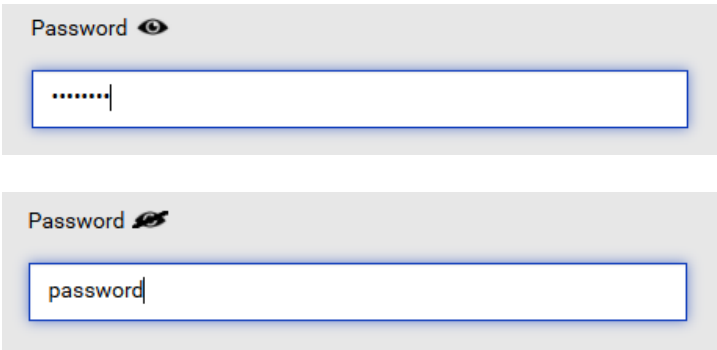
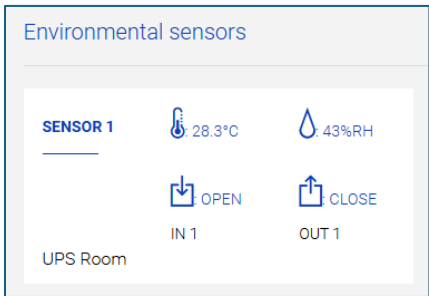
(June 2025)

Brief





It is always recommended to upgrade to the latest available version of the firmware.

This update APP 1.10 is strongly related to the SYS 1.4 firmware: in case of previous versions please update to the SYS 1.4 firmware.

Brief list of New Features and changes

Password optionally visible in fields	<p>Passwords can be shown (👁) by request of User</p> 
Sensors fix and improvements	<p>General Sensors improvements. Added Sensors labels for Web and Email.</p> 

Release Notes for Netman 208 / APP version 1.10

	<p>Netman 208 Restore from alarm: Environmental sensor 1 IN 1 input</p> <div>  n.camon@riello-ups.com A  Nicola Camon </div> <p>2025/05/23 09:50:20 CEST Restore from alarm: Environmental sensor 1 IN 1 input alarm</p> <hr/> <p> Device model: SEP 1000 Serial number: ME39VOD20000018 IP address: 10.1.30.127 Hostname: devnicola208 System name: Netman 208 System location: Contact name: </p>
Email with residual % when on Battery	<p> Da: [REDACTED] Inviato: [REDACTED] A: [REDACTED] Oggetto: NetmanNessuno Alarm condition detected: On battery, remaining a </p> <p>2025/05/13 16:57:33 CEST Alarm condition detected: On battery, remaining autonomy 407 minutes</p> <hr/> <p> Device model: RT1K06 Serial number: MZ15UP218630001 IP address: 10.1.[REDACTED] Hostname: netmannessuno System name: NetmanNessuno System location: Contact name: </p>
NTP / Fix for NTP requests to external unwanted servers	<p>Fix a bug with previous NTP configuration: now only the NTP server set in the Web configuration is requested.</p> <p> After the FW APP update, please click to “SAVE” button in the NTP Server configuration Web page for activating the fix.</p>
CVE-1999-0524 (ICMP Timestamp reply) mitigation	<p>Mitigation for the CVE.</p> <p> After the FW APP update, please click to “SAVE” button in the Firewall configuration Web page for activating the mitigation.</p>

More improvements:

- COMM / Added GPSE commands RDB and RDP for newer modular UPSs and published the values over MODBus protocol
- COMM / Added new command Serial Number on SENTR devices
- SNMP / Optimized SNMP device and vendor name for some hardware configurations
- Login / Strength improvement of login process

and some fixes:

- Email / Fix Test email was not sent if no events are enabled

Release Notes for Netman 208 / APP version 1.10

- Report / Fix email report showed incorrect nominal data on some circumstances
- Fix for NTP Server might not be updated after first set
- Remote Hosts / Fix for Backslash "\" char read as escape char in configuration parameters (old SAMAccount Windows server format), for example for VMWare service
- Remote Hosts / Fix UPS shutdown action at the end of SSH client was not correctly performed
- Riello Connect / Fix RielloConnect service no longer show "Network problem" status while starting: now shows "Starting" state
- Factory Reset / Fixed the factory reset action didn't reset completely the network configuration
- Sensors / Fix sensors IDs were incorrectly managed on some circumstances
- Service Log / Cleaning Service Log unwanted files
- Service Log / NTP configuration file added to Service Log